Cleveland

Wheels & Brakes

Parker Hannifin Corporation
Aircraft Wheel & Brake
1160 Center Road, P.O. Box 158
Avon, Ohio 44011 USA
1-800-BRAKING (272-5464)
216-937-1272 ● FAX 216-937-5409

SERVICE BULLETIN

PART NUMBER 164-05006
PIPER AIRCRAFT MODELS 600, 601, 601P

PURPOSE: To advise Piper Aircraft owners that small heat checks on the wearing surface of the

brake disc, P/N 164-05006 can be expected to develop during normal service

operations. The 164-05006 brake disc is part of the 40-124 wheel assembly.

INSPECTION

PROCEDURE: At each periodic maintenance inspection, visually inspect both wearing surfaces of

brake disc, P/N 164-05006 for heat checks or cracks.

ACCEPTANCE: Heat checks are considered to be superficial surface cracks and are not detrimental

to the integrity or performance of the brake system.

REJECTION: Replace brake disc if crack length exceeds .800 inch or crack depth exceeds .250

inch.

If crack depth is not measurable, replace brake disc if crack length exceeds .400

inch.

